



## TECHNICAL BULLETIN

**MACHINE : POCKET MONEY**

**URGENCY : Machine will fail if the mod is not completed.**

**FAULT : Monitor chassis failure caused by poor earth connection on crt because the connection has been wrapped rather than soldered. Subsequent EHT flashover causes failure of components D8 and D14 on the main chassis.**

**SOLUTION : Remove the earth connection that runs from the neck pcb to the tube strap at the tube end. Pre-tin the end of the earth lead and the tube strap and solder together.**

SOLDER AT THIS POINT

