

## SERVICE BULLETIN

## No. 1118-E

Name of Product\_\_\_\_EIGHT\_BALL\_\_\_\_

Effective All Games

October 1, 1977

## THE FOLLOWING IS A LIST OF CORRECTIONS TO BE MADE ON ALL EIGHT BALL SCHEMATICS:

Schematic W-1182-3c

- A. Next to R68, ADD R69
- B. On J3, change J3-3 to S.P.S.A: J3-13 to CREDIT IND.
- C. Change

R8 to R9 to R10 to R11 to R4 to	R16 R17 R18 R8 R7	R1 to   R2 to   R3 to   R7 to   R16 to	R6 R5 R4 R1 R20	R5 to R6 to R35 to R34 to R22 to	o R2 o R36 o R35
R26 to R25 to R24 to R17 to R23 to	R23 R22 R33 R21 R32	R21 to R15 to R18 to R19 to R33 to	R9 R19 R15 R11 R34	R31 to R36 to R38 to R44 to R49 to	o R45 o R41 o R43
R48 to R37 to R32 to R20 to R42 to	R51 R38 R25 R10 R47	R41 to R40 to R39 to R47 to R43 to	R48 R46 R24 R49 R44	R45 to R50 to R51 to R54 to R55 to	o R55 o R56 o R58
R60 to R59 to R58 to R56 to R46 to	R54 R53 R50 R60 R40	R52 to R53 to	R37 R39		

Schematic W-1186-3, Sheet 2 of 3, top middle: +43VDC bus line (effective game serial #1907):

- A. Change 30 to 60, A2J1-6 (Wire Color Code)
- B. Add fuse, +43VDC bus, between right flipper and outhole ball eject coils



## SERVICE BULLETIN

No. 1118-E

Name of Product	EIGHT	Г BALL
Effective	A11 6	amos

October 1, 1977

Page 2


- C. Add fuse description, "1 Amp, S.B., E-133-44". Substitutions other than BALLY part number not recommended
- D. Outhole side of fuse, wire color is 30

Schematic W-1186-3, Sheet 1 of 3, effective game serial #1907:

A. A2J1, Pin 6, change color 30 to 60

B.M. Powers Field Service Manager

Page 2 of 2

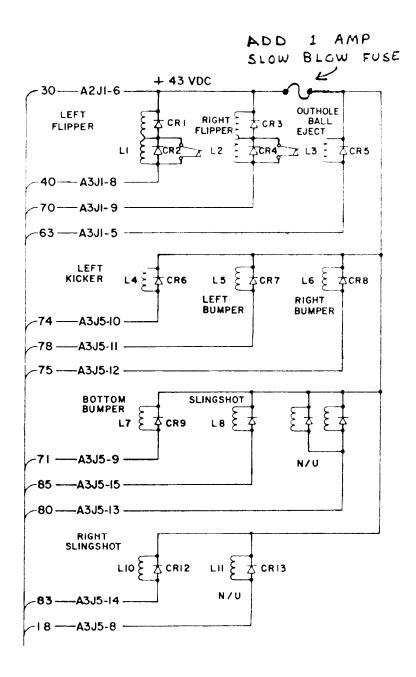

S