



DATA EAST PINBALL, INC.

SERVICE BULLETIN

May 6, 1988

Game: Secret Service

#007

Subject: Flipper Assembly Change

Symptom: After a period of operation, the screw that holds the flipper bushing (pawl) to the flipper link works loose.

Problem: The screw is not "biting" into the nylon portion of the ny-lock nut. This is due to a 1/32" flat washer that was added between the nut and the bushing.

Solution: Remove the washer and replace the nut making sure the screw is protruding slightly past the head of the nut.

NOTE: We started removing the washer on Secret Service Serial #10160. Any game with a serial # lower than this should be checked.

Pete Gustafson  
Field Service Manager  
Data East Pinball, Inc.