


Service Bulletin N^o 109

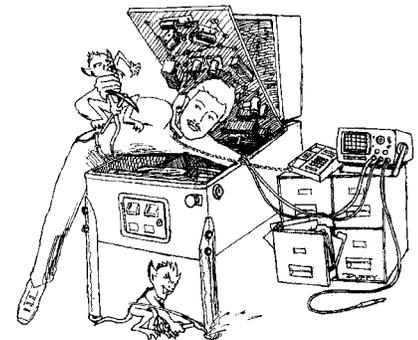

Joe Blackwell Director, Parts Sales & Technical Support	Susan Molitor Parts Sales Manager	Patty Schraps Parts Stockroom Manager	Eric Winston Technical Support Engineer	Doug Lemons Technical Support Engineer	Linda Garza Customer Service Representative	Jay Alfer Technical Support Doc. Administrator
--	--	--	--	---	--	---

TO: Parts & Service Managers

DATE: September 30, 1998



SUBJ: GODZILLA PINBALL GAME MANUAL ADDENDUM: Flipper Coils

Explanation:

After further field testing, our Engineering Staff had determined stronger Flipper Coils would greatly enhance the play and feel of the Godzilla Pinball. Therefore, the Left & Right Flipper Coils were changed in Production from 23-1100, Orange (090-5030-00T) **TO** 22-1080, Yellow-Green (090-5032-00T). This will also change the Assembly Part N^o for both Flippers 500-5944-14 **TO** 500-5944-12 (Left) and 500-5944-04 **TO** 500-5944-02 (Right). If you have an early production game and have determined you have the "Orange" wrap Flipper Coils, please call Technical Support for Assistance.

The following pages in the **GODZILLA GAME MANUAL** have changed (due to the Flipper Coils). A copy of this Service Bulletin will be included with the Game Manual for pinballs remaining in the factory. Please ensure your Game Manual has this copy. The below Addendum Table annotates all areas in the manual where the now incorrect Flipper Coil is referenced.

Addendum:

Page: DR. ⑥ Coils Detailed Chart Table Item #15 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T	Page: DR. ⑥ Coils Detailed Chart Table Item #16 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T
Page: ii Table of Contents "Page 72" From: (Left) ...500-5944-14 TO: (Left) ...500-5944-12	Page: ii Table of Contents "Page 73" From: (Right) ...500-5944-04 TO: (Right) ...500-5944-02
Page: 22 Coil & Flash Lamp Desc. "Coil 15" From: (23-1100) TO: (22-1080)	Page: 22 Coil & Flash Lamp Desc. "Coil 16" From: (23-1100) TO: (22-1080)
Page: 24 Coils Detailed Chart Table Item #15 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T	Page: 24 Coils Detailed Chart Table Item #16 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T
Page: 25 ...Detailed Wiring Diagram Q15, J9 Pin-8 From: 23-100 TO: 22-1080	Page: 25 ...Detailed Wiring Diagram Q16, J9 Pin-9 From: 23-100 TO: 22-1080
Page: 72 Flipper (Left) Assembly, 500-5944-14 From: (Left) ...500-5944-14 TO: (Left) ...500-5944-12	Page: 73 Flipper (Right) Assembly, 500-5944-04 From: (Right) ...500-5944-14 TO: (Right) ...500-5944-12
Page: 72 Assembly Parts Table Item #16 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T	Page: 73 Assembly Parts Table Item #16 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T
Page: 80 Coils Detailed Chart Table Item #15 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T	Page: 80 Coils Detailed Chart Table Item #16 From: 23-1100 090-5030-00T TO: 22-1080 090-5032-00T
Page: 82 ...Detailed Wiring Diagram Q15, J9 Pin-8 From: 23-100 TO: 22-1080	Page: 82 ...Detailed Wiring Diagram Q16, J9 Pin-9 From: 23-100 TO: 22-1080
Page: 86 2-Flipper Circuit Wiring... Left Flipper From: 23-100 TO: 22-1080	Page: 86 2-Flipper Circuit Wiring... Right Flipper From: 23-100 TO: 22-1080
Page: 119 Appendix E... Godzilla Lower Flipper Left From: -5030- 23-1100 ORG TO: -5032- 22-1080 YEL-GRN	Page: 119 Appendix E... Godzilla Lower Flipper Right From: -5030- 23-1100 ORG TO: SAME

Any questions or concerns please contact Technical Support at the below numbers.

• 1990 Janice Avenue • Melrose Park, IL 60160 • Tel 708-345-7700 or Toll-Free (USA/Canada) 1-800-542-5377 • Fax 708-345-7889 •