
Service Bulletin Nº 65



Data East Pinball, Inc. 1990 Janice Avenue Melrose Park, IL 60160 © 1-800-KICKERS or © 708-345-7700 Fax: 708-345-7889

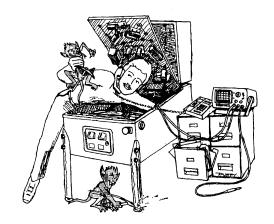

Technical Support

Joe Blackwell Director, Technical Support Eric Winston
Technical Support Engineer

Ted Kilpin
Technical Support Engineer

Jay Alfer Tech. Doc. Administrator

TO:

Parts & Service Managers

DATE:

November 2, 1994

RE:

Millian

F.Y.I. — Maverick Display 64 X 192 Dot Matrix Introduction

Our new display assembly is comprised of two major components:

1. **DISPLAY BOARD 64 x 192 DOT MATRIX**: Part Number 520-5075-00.

This display has its own on **Board Switching Power Supply**, which requires a 5v DC and 18v DC input. The 18v DC is used to generate the required high voltage of +68v DC and -110v DC. The manufacturers of this display are **CHERRY**, **BABCOCK** and **DALE**.

DISPLAY CONTROLLER BOARD: Part Number 520-5092-01.

The Display Controller uses a *68000 Microprocessor*. The processor runs at a *clock speed* of 12Mhz. Two **4 MB EPROMS** support the Display Controllers *graphic capabilities*. Due to the increased clock speed with the 12Mhz Clock, the Data Transfer Rate has also increased aboard the controller, requiring faster accessing **EPROMS** of **120ns**. The past generation of controllers used a *150ns 4 MB EPROM*, and *can not* be used in the new controller.

* An EPROM of 120ns or faster must be used.

**

If you have any questions or experience any other problems, please call our Technical Support Department.